

BEDIENUNGSANLEITUNG (INSTRUCTION MANUAL)



INHALTSVERZEICHNIS

<u>Titel</u>	<u>Seite</u>
I. SICHERHEITSINFORMATIONEN	2
Sicherheitssymbole	2
II. ALLGEMEINE BESCHREIBUNG	2
III. SPEZIFIKATION	3
IV. FUNKTIONEN	4
V. UHR UND EINSTELLUNGEN	7
VI. KALIBRIERUNG	8
VII. GERÄTEVORBEREITUNG	9
VIII. MESSVORBEREITUNGEN	9
IX. MESSUNG	10
X. Softwareeinstellung TestLink SE-322	10
XI. Verwendung der Mikrofonverlängerung	17

I. SICHERHEITSINFORMATIONEN

Lesen Sie bitte sorgsam die folgenden Informationen, bevor Sie mit den Messungen beginnen.

Benutzen Sie das Messgerät nur in der beschriebenen Form, anderenfalls erlischt die auf das Gerät gewährleistete Garantie.

Umweltbedingungen

- Relative Feuchtigkeit max. = 90% rH
- Arbeitstemperaturbereich = 0...+ 40 °C.

Wartung & Reinigung

- Reparaturarbeiten am Gerät sollten nur durch den Hersteller durchgeführt werden.
- Halten Sie bitte das Gerät sauber und in trockenem Zustand.

Das Gerät unterliegt den allgemein gültigen Normen und Standards (IEC651 Typ2, ANSI S1.4 Typ2) und ist CE-zertifiziert.

II. ALLGEMEINE BESCHREIBUNG


Das Datenspeicher-Schallpegelmeter SL 322 verfügt über einen internen Datenspeicher für 32000 Werte. Immer, wenn Sie den "REC"-Knopf drücken und nach der Messung wieder den "REC"-Knopf, dann wird ein Datensatz in den Speicher geschrieben. Mittels der USB – Schnittstelle können die Messwerte zum PC Übertragen werden.

III. SPEZIFIKATION

Standards:	IEC651 Type2, ANSI S1.4 Type2
Frequenzbereich :	31.5Hz ~ 8KHz
Messbereich :	30 ~ 130dB
Wichtung/Bewertung :	A / C
Mikrophon:	1/2 inch Electret Kondensator Mikrophon
Display1 :	LCD, 4-stellig
Auflösung:	0.1dB
Werteerneuerung:	0.5 s
Display2 :	50 Segment Bargraph
Resolution:	1dB
Werteerneuerung:	alle 50 ms
Zeitliche Bewertung:	FAST (125 ms), SLOW (1 sec.)
Messbereiche:	
Lo:	30 – 80 dB
Med:	50 – 100 dB
Hi:	80 – 130 dB
Auto:	30 – 130 dB
Genauigkeit:	±1.5dB (unter Referenzbedingungen @ 94 dB, 1KHz)
Alarmfunktionen:	“OVER” wird angezeigt, wenn der aktuelle Messwert höher als der gewählte Messbereich ist “UNDER” wird angezeigt, wenn der aktuelle Messwert niedriger als der gewählte Messbereich ist
MAX/MIN-Wert:	Hold-Funktion für den Kleinst- u. Höchstwert
AC-Ausgang:	1 Vrms / bezogen auf den Maximalwert des gewählten Messbereiches)
Ausgangsimpedanz :	ungefähr 100Ω
DC-Ausgang:	10mV / dB
Stromversorgung :	9V-Batterie (typisch für 50 Betriebsstunden)
AC-Adapter:	9 VDC (8-15VDC Max, Netzadapter)
Anliegende Versorgung:	> 30mADC Stecker: pin → Masse
Arbeitstemperatur:	0 ...+40 °C (32 ... +104 °C)

- Arbeitsfeuchte: 10 bis 90% rH
 Lagertemperatur: -10 ... 60 °C (14 ... 140 °C)
 Lagerfeuchte: 10 bis 75%rH
 Dimensionen: 275 (L) × 64 (W) × 30 (H)mm
 Gewicht: 285g (inkl. Batterie)
 Zubehör: 9V Batterie, Tragetasche, Schraubendreher,
 Bedienungsanweisung, Windschutz,
 3.5V-Stecker, Software, RS-232


IV. Funktionen

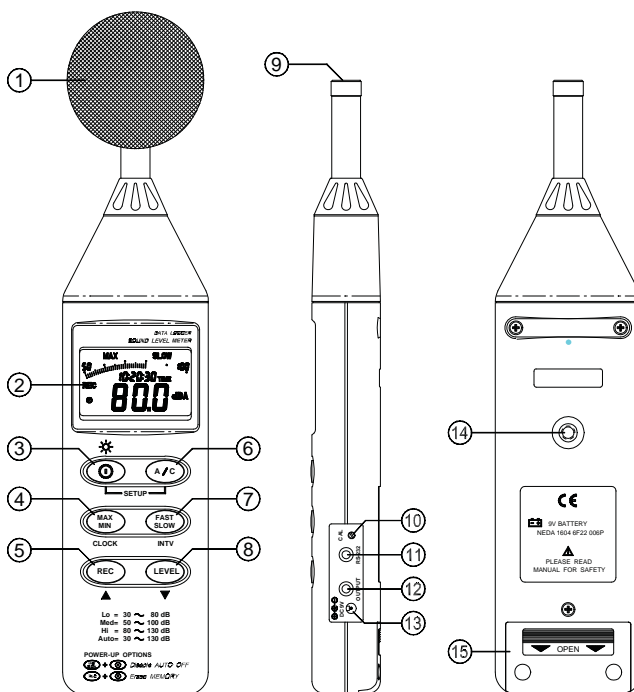

(1) Windschutz

Wenn Sie bei Windgeschwindigkeit > 10m/s messen, verwenden Sie bitte den Windschutz auf dem Mikrofon

(2) Display

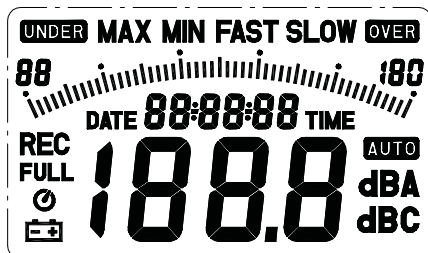

Symbol


MAX
MIN
OVER
UNDER
FAST
SLOW
dBA
dBC
88 - 180
[- +]
-LQ-

Funktion

Maximalanzeige
Minimalanzeige
Überbereichsanzeige
Unterbereichsanzeige
Schnelle Antwort
Langsame Antwort
A-Bewertung
C-Bewertung
Bereichswahl
Batterie "schwach"
Unterbereich 20dB

(3) Betrieb

Der (1) schaltet das Gerät und die Hintergrundbeleuchtung an und aus.

Drücken Sie die Taste einmal, um das Gerät ein- o. auszuschalten- halten Sie die  Taste einen Moment gedrückt, um Hintergrundbeleuchtung ein oder auszuschalten.

Halten Sie die Taste ca. 3s lang gedrückt, um das Gerät abzuschalten.

Anmerkung: Beim Einschalten wird der zur Verfügung stehende Speicherplatz angezeigt.

(4) MAX / MIN Halte-Taste

Durch Drücken dieser Taste wird nur der Max-Wert angezeigt. Der aktuelle Wert ist nur noch durch die Bargraph-Anzeige zu sehen. Durch weiteres Drücken der Max/Min-Taste wird nur der Min-Wert angezeigt. Um diesen Modus zu deaktivieren, halten Sie die Taste 2s lang fest.

(5) Datalogger-Taste

Wenn Sie diese Taste einmal drücken, beginnt das Gerät mit der Aufzeichnung. Ein weiteres Drücken stoppt die Datenaufzeichnung.

(6) Frequenz-Bewertungs-Taste

A: A-Bewertung für allgemeine Messungen

C: C-Bewertung zur Messung im niederfrequenten Bereich

(7) Taste für zeitliche Bewertung

FAST, (schnell): für normale Messungen und zur Erfassung von Schallspitzen

SLOW, (langsam): für die Messung des Durchschnitts-Pegels bei stark wechselnden Messwerten

(8) Bereichs-Kontroll-Taste

 
Immer, wenn Sie dies **LEVEL** Taste drücken, wechselt der Messbereich zwischen "Lo", "Med", "Hi" und "Auto" Level.

(9) Mikrofon

1/2 inch Electret Kondensator Mikrofon

(10) CAL-Potentiometer

Wird zur Kalibrierung des Gerätes benutzt (Abschnitt Kalibrierung).



(11) RS-232 Schnittstelle:

RS-232 – Signalausgang: 9600 Baud N, 8, 1, seriell.

(12) Signalausgabe

AC: 1 Vrms, jeweils anliegend beim Maxwert eines jeden Messbereiches (verwendet wird zur Übertragung ein Standard-Koaxialkabel 3,5 mm)

Bemerkung: Im "Auto" Level-Bereich müssen Sie "Lo" oder "Med" oder "Hi" – Bereichswahl vorgeben.

DC: 10mV/dB

Ausgangsimpedanz 1 K Ω

(verwendet wird zur Übertragung ein Standard-Koaxialkabel 3,5 mm)

(13) Externer DC 9V-Eingang für Adapter-Spannungsversorgung

(14) Gewindebohrung zur Montage eines Stativs

(15) Batteriefachdeckel

V. UHR UND EINSTELLUNGEN

▪ DataLogger:

1. Wenn Sie die "REC"-Taste einmal drücken, beginnt die Aufzeichnung. Wenn Sie die Taste wieder drücken, wird die Aufzeichnung gestoppt.
2. Wenn Sie die gespeicherten Daten **löschen** möchten, schalten Sie das Gerät aus, drücken und halten Sie den "REC"-Schalter zusammen mit dem Ein-Schalter für 5 Sekunden. Dann erscheint "CLR" und "SURE" auf dem Display.



▪ Uhr Setup :




1: Drücken u. halten sie die "A/C" – Taste und schalten Sie das Gerät ein.

2: Drücken Sie die "MAX MIN"(Uhr)-Taste:

3: Drücken Sie die "REC" ▲-Taste oder die "LEVEL" ▼ – Taste, um den nächsten Menüpunkt auszuwählen. Die Auswahlreihenfolge ist "year :

month : day : hour : minute" (Jahr, Monat, Tag, Minute). Dann drücken Sie die "MAX MIN"(Uhr) – Taste noch einmal, um den Vorgang zu beenden.

Aufnahmeeinstellungen:

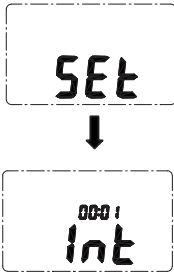


- 1: Drücken u. halten Sie die "A/C" – Taste und schalten das Gerät ein:
- 2: Wählen Sie "FAST/SLOW"(INTV):
- 3: Drücken Sie "REC" ▲ oder "LEVEL" ▼ um die jeweilige Einstellung vorzunehmen. Ebenso für "FAST/SLOW " (INTV) und noch einmal "FAST/SLOW" (INTV), um die Einstellungen zu beenden. Wenn Sie den Vorgang abrechnen möchten, schalten Sie das Gerät einfach ab.

Auto Power Off:

Standardmäßig schaltet sich das Gerät nach 30 min ab. Diese Funktion lässt sich abschalten. Drücken und Halten Sie die "FAST/SLOW" – Taste, schalten Sie das Gerät ein und die autom. Abschaltung ist ausgeschaltet.

VI. KALIBRIERUNG

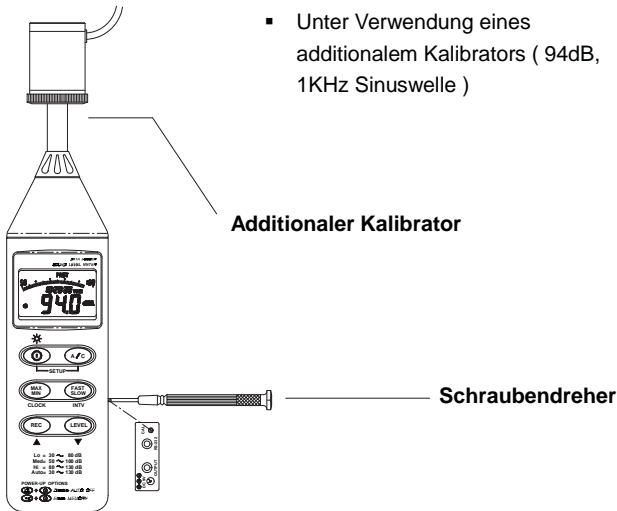

- Unter Verwendung eines additionalen Kalibrators (94dB, 1KHz Sinuswelle)

- (1) Stellen Sie das Gerät wie folgt ein: Display = dBA, zeitl. Bewertung = FAST, Messmodus: MAX MIN Mode- Funktion ausstellen, Messbereich: 50 ... 100dB
- (2) Stecken Sie das Gerät mit der Mikrofonspitze in die Öffnung des Kalibrators.
- (3) Schalten Sie die Kalibrierfunktion ein und justieren Sie das Gerät mittels der Potentiometerschraube auf exakt 94 dB ein (Anzeigewert im Display). Allgemein: Das Gerät ist werksseitig kalibriert – eine Nachkalibrierung ist je nach Einsatzzweck sinnvoll.

VII . GERÄTEVORBEREITUNG

(1) Batterie

Entfernen Sie den Batteriedeckel u. legen Sie die 9V Batterie ein.

(2) Batterietausch

Wenn die zur Messung benötigte Spannung abfällt, erhalten Sie ein  Warnzeichen. Es ist die Batterie zu tauschen.

(3) AC Adapter

Wenn Sie einen AC-Strom-Adapter benutzen, stecken Sie diesen bitte an den DC9V- Anschluss an der Seite des Gerätes an.

VIII. MESSVORBEREITUNGEN

Bei Wind sollten Sie den Windschirm aufsetzen.

- (1) Das Gerät sollte kalibriert sein.
- (2) Benutzen Sie das Gerät nur im Bereich der spezifizierten Umweltbedingungen.
- (3) Schützen Sie das Mikrofon vor Feuchtigkeit u. halten Sie das Gerät sauber.
- (4) Achten Sie bitte darauf, dass eine "volle" Batterie eingesetzt ist (Wenn Sie das Gerät längere Zeit nicht benutzen, so entfernen Sie bitte die Batterie)

IX. MESSUNG

- (1) Schalten Sie das Gerät ein und wählen Sie die von Ihnen gewünschten Parameter und Einstellungen aus. Standardmäßig wird die A-Bewertung verwendet, um dem menschlichen Hörempfinden nahe zu kommen.
- (2) Halten Sie das Messgerät in Richtung der Schallquelle
- (3) Wenn Sie die Min-Max-Hold-Funktion angewählt haben, halt das Gerät diese Werte fest. Drücken Sie die MAX-MIN-Taste 2 Sekunden fest, um die "alten" Werte aus dem Display zu löschen.

X. Softwareeinstellung TestLink SE-322

- **Das Link-Paket beinhaltet:**
 - 1.) 80mm CD-ROM
 - 2.) USB-Verbindungskabel
- **Systemvoraussetzungen:**

Windows 95 oder Windows 98
- **Hardwarevoraussetzungen:**

PC oder Notebook mit Pentium 90MHz oder höher, 32 MB RAM, Min. 5 MB verfügbarer Festplattenspeicher zur Installation.
- **Anleitung zur Installation des USB-Treibers USB-120 und für Software USB-300**
- **Paket enthält:**
 - 1.) Installations-CD
 - 2.) USB-RS232-Adapter
 - 3.) Anleitung
- **Benötigtes System:**

Windows 95/98/2000NT 4.0/XP oder höher
- **Benötigte Hardware:**


PC oder Laptop mit USB-Anschluss

- **Installation TestLink:**

- 1.) Wir empfehlen alle anderen Anwendungen vor dem Installationsstart zu schließen.
- 2.) Bitte stecken Sie nicht den USB-Stecker vor der Installation in den PC.
- 3.) Bitte legen Sie die Installations-CD in das Laufwerk ein. Das Installationsprogramm startet automatisch. Falls nicht, bitte rufen Sie über die Startleiste den Menüpunkt „Ausführen“ auf. Geben Sie den Laufwerksbuchstaben für das CD-Laufwerk ein und rufen das „SETUP“ auf. Z.B.: E:\SETUP
- 4.) Während der Installation wird das nachfolgende Fenster gezeigt. Bitte „Next“ anklicken.




- 5.) Wenn das nachfolgende Fenster erscheint, bitte den USB-Stecker anschließen, die Installation erkennt das Instrument.

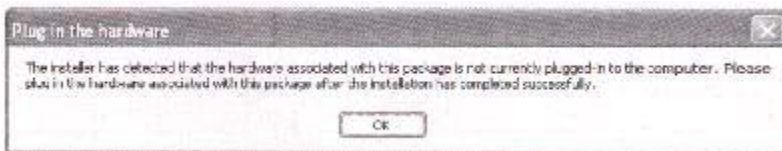

- 6.) Nach erfolgreicher Installation rufen Sie bitte über die Startleiste „Einstellungen“ und anschließend „Systemsteuerung“ bzw. „System“ auf.



- 7.) Wählen Sie die Option “Hardware” aus und klicken dann auf “Gerätemanager”. Wählen Sie in der Liste “Ports” bzw. “ser. Eingänge” (+ Symbol) aus und klicken das + Symbol an. Kontrollieren Sie ob in der Liste “CP2101 USB to UART Bridge Controller” vorhanden ist.

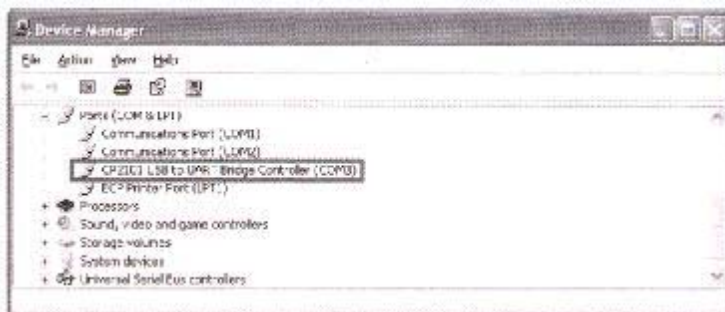

- **Installation:**

1. Alle Anwendungen schließen. Schieben Sie die Diskette 1 in das Laufwerk
2. Betätigen Sie die “Start”-Schaltfläche u. wählen Sie “Run”. Geben Sie ein: A:\SETUP und drücken Sie “OK”. Die Dateien werden dann auf Ihre Festplatte kopiert.

- **Haupt-Menü**

File | Open - ... öffnet Dateien von der Diskette

Save – Speichert die Bildschirmdateien auf der Diskette

Print – Druckt die aktuelle Bildschirmoberfläche aus

Printer Setup – Sie können den Drucker auswählen

File | Exit: Beendet das Programm.

View | Control Panel: Beim ... Öffnung dieses Fensters können Sie die Messung “online” beobachten

View | Real-Time Graph: Hiermit können Sie sich in Echtzeit eine grafische Darstellung der Messungen ansehen


Real Time Data | Run – Hiermit starten Sie die Darstellung der Messwerte

Stop – Hiermit stoppen Sie die Echtzeitdarstellung der Messwerte

DataLogger: Hiermit können Sie gesammelte Daten aufrufen

Output To Graph – Hiermit können Sie die Werte grafisch anzeigen

Graph

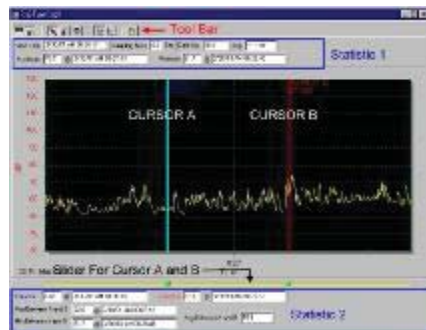

Schaltflächen







- Anzeigen oder Verdecken von Statistik 1



- Anzeigen oder Verdecken von Statistik 2





- Cursor

-  - Das Drücken dieser Schaltfläche verwandelt den Cursor in ein Kreuz – mit dem Kreuz können Sie Markierungen vornehmen
-  - Das Drücken dieser Schaltfläche verwandelt den Cursor in ein "I"-Zeichen
-  - Farbgrafik
-  - Graustufen-Grafik

Sie können den schwarzen Pfeil zum "zoomen" benutzen. Bei "Doppel-Klicken" auf die Grafik öffnen Sie die Dialog-Funktion. Hier können Sie Grafikeinstellungen nach Ihren Wünschen vornehmen. Durch Drücken der rechten Maus-Taste erhalten Sie ein Schnell-Menü.

DataLogger

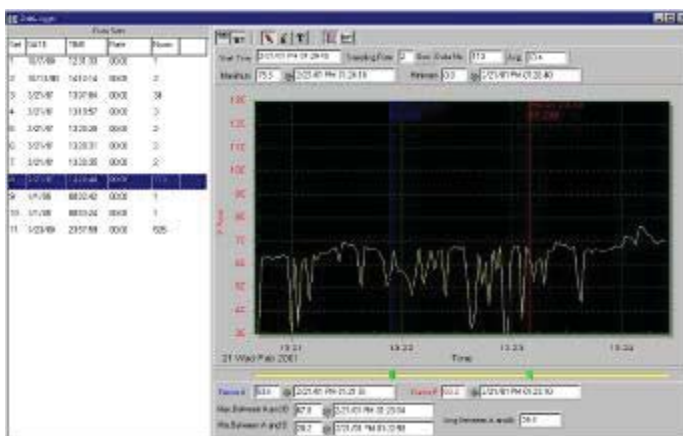

Wenn Sie das Gerät mit einem PC verbunden haben drücken Sie  (oder über die Auswahl im Hauptmenü "Datenlogger"), mit dem Schallpegelmeter gespeicherte Daten zum PC zu übertragen. Sie erhalten kontinuierliche Informationen über den Fortgang des Übertragungsprozesses. (Sollten Sie eine Fehlermeldung erhalten, drücken Sie erneut "Datenlogger") Nachdem die Daten übertragen wurden, wird auf der linken Seite angezeigt, wie viele Datensätze übertragen wurden (auch Startzeit, Sammelzeit usw.).

Beispiel folgend:

Data Sets				
Set	DATE	TIME	Rate	Nums
1	1999/7/25	PM 01:24:52	00:02	10
2	1999/7/25	PM 01:25:38	00:02	5142
3	1999/7/25	PM 09:29:08	00:02	21
4	1999/7/25	PM 09:32:04	00:02	3
5	1999/7/25	PM 09:32:09	00:02	1
6	1999/7/25	PM 09:32:14	00:02	9
7	1999/7/25	PM 10:03:43	00:02	1896
8	1999/7/25	PM 11:06:57	00:02	3
9	1999/7/25	PM 11:49:47	00:02	9086


Durch Anklicken eines Datensatzes holen Sie ihn sich auf den Bildschirm

▪ Tutorial – Online - Schnellstart

(1.) Aufnahme von Daten in Echtzeit in Wellenform

1. Schalten Sie das Gerät ein und verbinden Sie es mit dem PC
2. Starten Sie das SE322- Programm
3. Nun werden die Messdaten am Gerät parallel auf dem Bildschirm angezeigt




4. Drücken Sie  um die Darstellung in Echtzeit zu starten
5. Drücken Sie  um die Darstellung zu stoppen

(2.) Wie speichert man die Echtzeit-Daten ab?

1. Drücken Sie auf die Grafik, die Sie speichern möchten und wählen Sie dann "File | Save" aus dem Hauptmenü aus oder

Daten werden Übertragen)

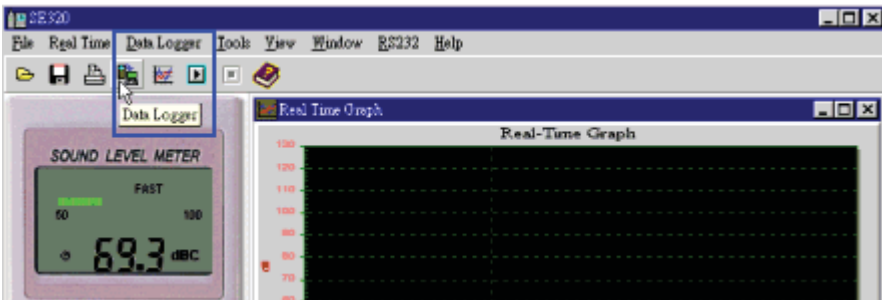

▪ Fehlermöglichkeiten

(1.) Anzeige „NO CONNECTION“

Es kann sein, dass die seriellen Schnittstellen durch andere Anwendungen benutzt werden → schließen Sie alle Anwendungen und starten Sie den PC neu.

(2.) Datenübertragungsfehler

Dies kann an einer zu kurzen Antwortzeit bestimmter Notebooks oder PC's liegen.

XI. Verwendung der Mikrofonverlängerung

Um Messungen durchzuführen ohne das Messgerät der Witterung auszusetzen kann man optional eine Mikrofonverlängerung käuflich erwerben. Zur Verwendung dieser Verlängerung wird die Rändelmutter direkt unterhalb des Mikrofons gedreht. Dadurch wird das Mikrofon aus seiner Steckverbindung gelöst

Achtung: Niemals direkt das Mikrofon drehen, da durch dieses Drehen das Mikrofon beschädigt wird.

CONTENTS

<u>Title</u>	<u>Page</u>
I. SAFETY INFORMATION	19
Environment conditions	19
Maintenance & Clearing	19
Safety symbols	19
II. GENERAL DESCRIPTION	19
III. SPECIFICATIONS	20
IV. NAME AND FUNCTIONS	21
V. CLOCK & INTV SETUP	24
DataLogger	24
Clock Setup	24
Recording Interval Setup	25
Auto Power Off	25
VI. CALIBRATION PROCEDURES	26
VII. MEASUREMENT PREPARATION	27
VIII. OPERATING PRECAUTIONS	27
IX. MEASUREMENT	27
X. Setup TestLink SE-322 (Sound Level Meter) – USB interface software	28

I. SAFETY INFORMATION

Read the following safety information carefully before attempting to operate or service the meter.

Use the meter only as specified in this manual; otherwise, the protection provided by the meter may be impaired.

Environment conditions

- Altitude up to 2000 meters
- Relatively humidity 90% max.
- Operation Ambient 0 ~ 40°C

Maintenance & Clearing

- Repairs or servicing not covered in this manual should only be performed by qualified personnel.
- Periodically wipe the case with a dry cloth. Do not use abrasives or solvents on this instruments.

Safety symbols

 **Comply with EMC**

When servicing, use only specified replacement parts.

II. GENERAL DESCRIPTION

Thank you for using our Data Logger Sound Level Meter. To ensure that you can get the most from it, we recommend that you read and follow the manual carefully before use.

This unit conforms to the IEC651 type2, ANSI S1.4 Type2 for Sound Level Meters.

This Data Logger Sound Level Meter internal memory can keep up to 32000 records.(Note 1.)

It uses USB interface to perform bi-directional communication with PC.

Note1:


Every time you press "REC" button to start recording data and press "REC" button again to stop recording, there will be a data set in memory, you can store as many data sets as you want unit memory is full.

III. SPECIFICATIONS

Standard applied:	IEC651 Type2, ANSI S1.4 Type2.
Frequency range:	31.5Hz ~ 8KHz
Measuring level range:	30 ~ 130dB
Frequency weighting:	A / C
Microphone:	1/2 inch electret condenser microphone
Display:	LCD
Digital display:	4 digits
Resolution:	0.1dB
Display Update:	0.5 sec.
Analog display:	50 segment bargraph
Resolution:	1dB
Display Update:	50 mS
Time weighting:	FAST (125 ms), SLOW (1 sec.)
Level ranges:	
Lo:	30 – 80 dB
Med:	50 – 100 dB
Hi:	80 – 130 dB
Auto:	30 – 130 dB
Accuracy:	±1.5dB (under reference conditions @ 94dB, 1KHz)
Dynamic range:	100 dB
Alarm function:	“OVER” is when input is more than upper limit of range. “ UNDER ” is when input is Less than lower limit of range.
MAX/MIN hold:	Hold readings the Maximum and Minimum Value.
AC output:	1 Vrms at FS (full scale).
Output impedance:	Approx. 100Ω
FS:	means the upper limit of each level range.
DC output:	10mV / dB , output impedance approx. 1KΩ
Power supply:	One 9V battery, 006P or IEC 6F22 or NEDA 1604.
Power life:	About 50hrs (alkaline battery)

- AC adapter: Voltage 9 VDC (8-15VDC Max)
 Supply current : > 30mADC
 Socket: pin → Ground
 Casing → Positive
 External Diameter → 3.5mm
 Internal Diameter → 1.35mm
- Electromagnetic Compatibility:
 RF field = 3V/m
 Total accuracy = specified accuracy + 0.5dB
- Operation temperature: 0 to 40°C (32 to 104°C)
 Operation humidity: 10 to 90%RH
 Storage temperature: -10 to 60°C (14 to 140°C)
 Storage humidity: 10 to 75%RH
 Dimensions: 275 (L) ×64 (W) ×30 (H)mm
 10.8 (L) ×2.5 (W) ×1.2 (H)inch
- Weight: 285g (including battery)
 Accessories: 9V battery, carrying case, Screwdriver,
 Instruction manual. Windscreen, 3.5ϕ plug,
 software, RS-232 cable.

IV. NAME AND FUNCTIONS

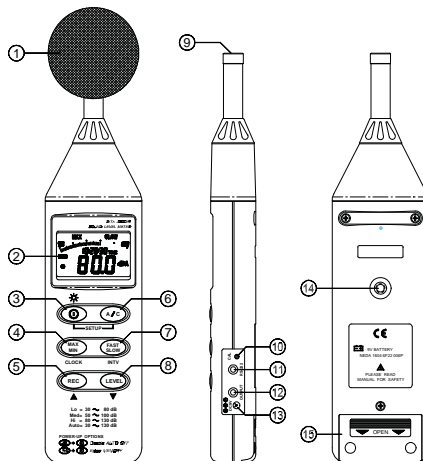



(1) Windscreen

If you operate at wind speed over 10m/sec, please put protective accessories in front of the microphone.

(2) Display



<u>SYMBOL</u>	<u>FUNCTION</u>
LCD	4 digits
MAX	Maximum indication
MIN	Minimum indication
OVER	Over range
UNDER	Under range
FAST	Fast response
SLOW	Slow response
dBA	A-Weighting
dBC	C-Weighting
88 - 180	Range Indicate
	Low-Battery
-LQ-	Under range 20dB
AUTO	Auto Level range selective
REC	Recording Datalogger
FULL	Memory full
	Auto Power OFF active

(3) Power & Backlight button

The (1) key turns the sound level meter ON or OFF and backlight ON & OFF.


Press it once to turn on the sound level meter.


Press it again for moment to turn ON or OFF backlight.

Press and hold this button 3 second to turn OFF the power.

Note: When the user power it on, the LCD will show how much memory space is available to use.


(4) MAX / MIN hold button

Press  button to enter the maximum and minimum recording mode. Select the proper Level range before using MAX/MIN to ensure that reading value will not exceed the measurement range. Press once to select MAX value. Press again to select MIN value, and press again to select current value with “MAX MIN “ annunciator blinking.

Press  and hold down button for 2 seconds to exit the MAX MIN mode.

Note: If change sound level range or change A-C weight, the MAX.MIN mode will clear.

(5) Record Datalogger button

When one press the  button, the meter will star recording. The “REC” annunciator are display, press again will stop recording.

(6) Frequency Weighting select button

A : A - Weighting. for general sound level measurements.

C : C - Weighting. for checking the low-frequency content of noise.


(If the C-Weighted level is much higher than the A-weighted level, then there is a large amount of low-frequency noise)

(7) Time weighting select button

FAST : for normal measurements

SLOW : for checking average level of fluctuating noise.

(8) Level range control button

 
Each time you press  button, the level range will change between “Lo” level, “Med” level, “Hi” level and “Auto” level in the circular.

(9) Microphone

1/2 inch Electret Condenser microphone

(10) CAL potentiometer

Calibration control, For level calibration adjustment.



(11) RS-232 Interface:

The RS-232 signal output is a 9600 bps N, 8, 1 serial interface.

(12) Signal output terminal

AC: 1 Vrms Corresponding to each range step.

Output impedance 100Ω

 
Output signal by standard 3.5mm coaxial socket signal on pin.

Note: At “Auto” level range, output signal is Auto select on “Lo” or “Med” or “Hi” level range.

DC: Output: 10mV/dB

Output impedance 1KΩ

Output signal by standard 3.5mm coaxial socket signal on middle.



(13) External DC 9V power supply terminal

For connection with AC adapter.

(14) Tripod mounting screw.

(15) Battery Cover

V. DATA LOGGER CLOCK & INTERVAL SETUP

▪ **DataLogger:**

When one presses the "REC" button, the meter will start recording, and pressing the "REC" button again will stop recording, If you want to clear the memory, power off the meter, then press and hold "REC" button and then press power button and hold at least 5 seconds, then LCD will show "CLR" and "SURE" to clear the memory.



▪ **Clock Setup :**



1: press and hold **"A/C"** button and then power on the meter:



2: press **"MAX MIN"**(clock) button:

3: press **"REC"** ▲ or **"LEVEL"** ▼ to increase or decrease number, press **"MAX MIN"**(clock) to adjust next item. The adjusting order is year→ month→ day→ hour→ minute, then press **"MAX MIN"** (clock) to finish adjusting. If you want abort during a setup process, press power button to cancel.

▪ **Recording Interval Setup :**



1: press and hold **"A/C"** button and then power on the meter:




2: press **"FAST/SLOW"**(INTV) button:


3: press **"REC"** ▲ or **"LEVEL"** ▼ to increase or decrease number, press **"FAST/SLOW "** (INTV) to adjust next item, then press **"FAST/SLOW"** (INTV) to finish. If you want abort during a setup process, press power button to cancel.

▪ **Auto Power Off:**

By default, when the meter is powered on, it is under auto power off mode. The meter will power itself off after 30 minutes if no key operation and no USB communication and no recording combination at power on can disable auto power off.

One may press and hold **"FAST/SLOW"** button and then power on the meter and the  will not show up to indicate that auto power off is disabled.

VI. CALIBRATION PROCEDURES

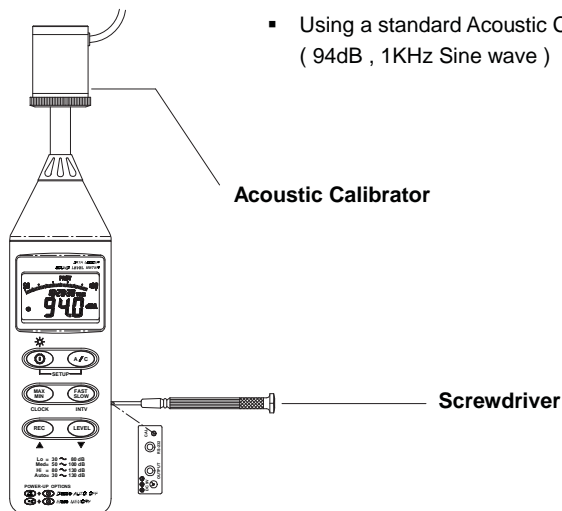

- Using a standard Acoustic Calibrator
(94dB , 1KHz Sine wave)


- (1) Make the following switch settings.
 Display : dBA
 Time weighting : FAST
 Measurement mode : MAX MIN Mode function disable.
 Level range : 50 to 100dB
- (2) Insert the microphone housing carefully into the insertion hole of the calibrator.
- (3) Turn on the switch of calibrator and adjust the CAL potentiometer of the unit . The level display will indicate the desired level.
 All products are well calibrated before shipment.
 Recommended Recalibration cycle: 1 year.

VII . MEASUREMENT PREPARATION

(1) **Battery Loading**

Remove the battery cover on the back and put in one 9V Battery.

(2) **Battery Replacement**

When the battery voltage drops below the operating voltage, this symbol will appear . Replace 9 Volt battery.

(3) **AC Adapter Connection**

When the AC adapter is used , insert the plugs of the adapter into the DC9V connector on the side panel.

VIII. OPERATING PRECAUTIONS

- (1) Wind blowing across the microphone would bring additional extraneous noise. When using the instrument in the presence of wind, it is a must to mount the windscreen to not pick up undesirable signals.
- (2) Calibrate the instrument before operation if the instrument was not in use for a long time or operated in bad environment.
- (3) Do not store or operate the instrument at high temperature and high humidity environment.
- (4) Keep microphone dry and avoid severe vibration.
- (5) Please take out the battery and keep the instrument in low humidity environment. When not in use.

IX. MEASUREMENT

- (1) Open battery cover and install a 9V battery in the battery compartment.
- (2) Turn power on and select the desired response Time and Weighting. If the sound source consists of short bursts or only catching sound peak, set response to FAST. To measure average sound level, use the SLOW setting.
Select A-weighting for general noise sound level and C-weighting for measuring sound level of acoustic material.
- (3) Select desired Level.

- (4) Hold the instrument comfortably in hand or fix on tripod and point the microphone at the suspected noise source, the sound pressure level will be displayed.
- (5) When MAX MIN (maximum, minimum hold) mode is chosen. The instrument captures and holds the maximum and minimum noise level for a long period using any of the time weightings and ranges. Press the MAX MIN button 2 seconds to clear the MAX/MIN reading . “ MAX/MIN ” symbol disappears.
- (6) Turn OFF the instrument and remove battery when not in use.

X. Setup TestLink SE-322 (Sound Level Meter)– USB interface software:

- **The TestLink package contains:**
 - 1.80mm CD.
 - 2.Custom designed USB cable for TestLink.
- **System Required:**

Windows 95 or Windows 98 or Windows NT 4.0 above.
- **Minimum Hardware Required:**

PC or NoteBook with Pentium 90MHz or higher, 32 MB RAM ;
At least 5 MB byte hard disk space available to install TestLink.
Recommended resolution 800X600.
- **USB-120 / USB-300 Driver Installation Guide**
- **Package contains:**
 - (1) Install CD
 - (2) USB to RS232 adaptor
 - (3) Install manual
- **System Required:**

Windows 95/98/2000NT 4.0/XP or above
- **Hardware Required:**


PC or Laptop with USB port

- **Install TestLink:**


- 1.) We recommend close all other application before installing driver.
- 2.) We recommend not plug connector to USB port before installation.
- 3.) Insert setup CD disk to CD disk drive, installation will execute automatically. If not, execute "start" → "run", and edit X:\SETUP (X is your disk drive), then click OK button, installation will start.
- 4.) While installing, it will show this window below, just click "next" to continue.




- 5.) When this window below appears, please plug in the connector to USB port, installation will confirm the device.

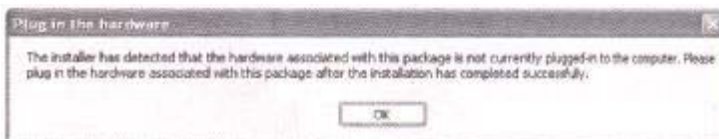

- 6.) After finish installation, execute "start" → "My Computer", then choose "View System Installation" on the left top of the window, the window below will show up:

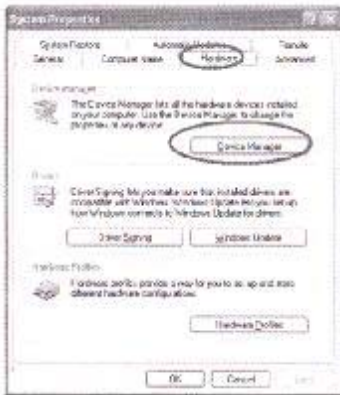

- 7.) Choose “Hardware” option and click “Device Manager” button, click “+” symbol on the left side of Ports (COM & LPT), if the device “CP2101 USB to UART Bridge Controller (COMx)” is in the list, the connector is ready to work.

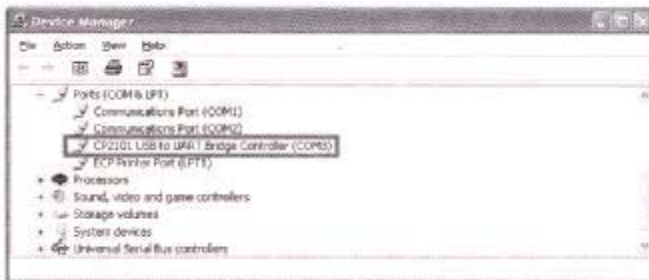

▪ **Install TestLink:**

- 1.We recommend close all other application before installing TestLink
- 2.Insert setup CD disk to CD disk drive.
- 3.Choose the Start button on the Taskbar and select Run.
- 4.Type E:\SETUP and choose OK, then it will copy SE322.exe (executable file) and help file to your hard disk (default is c:\program files\TestLink\SE322).
For detailed other operation instruction, please refer to the online help while executing SE322.

▪ **Main Menu**

File | Open - Retrieve files from the disk.

Save - Save the active window (when the caption bar is highlighted) data to the disk.

Print - Print the data of the active window (graph or list).

Printer Setup - Select printer.

File | Exit: Terminates TestLink program.

View | Control Panel: By opening the Panel Window, the user can control meter via the button in this window.

View | Real-Time Graph: Open Real-Time Graph display to graph the present data.


Real Time Data | Run - Start collecting real time data .

Stop - Stop collecting real time data .

DataLogger: By opening the DataLogger Window, the user can load recorded data of meter to PC in this window.

Output To Graph - Graphing tabular data . interface. For better result, the user may close the panel window .

Graph

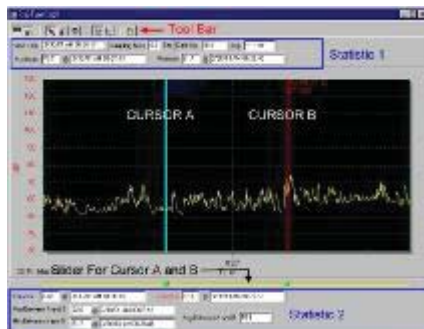

Tool Bar



- Display or hide Statistic1.



- Display or hide Statistic2.



- Normal cursor.



- When selected, the mouse cursor will become a cross sign when moving to the graph, click on the graph to mark a cross sign on the graph.



- When selected, the mouse cursor will become a "I" sign when moving to the graph, click on the graph to annotate.



- Color graph.



- Monochrome graph.

You can choose a rectangle area on the graph to zoom in for detail. There are two vertical line (CURSOR A and CURSOR B) in the graph. There are time and value display on top and right side of each cursor. You can move mouse cursor over cursor A or B and click to drag cursor to move left or right. Right below cursor A and B is a slider. You can also click and drag slider to move cursor A or B. Below the slider is the statistic, it displays start time, sampling rate, data number, maximum and minimum of the graph. The statistic also displays the maximum, minimum and average between cursor A and B and these data will update automatically when cursor A or B is moving. You can double click the graph to call the option dialog. In option dialog, it is allowed to customize your graph style. And you can right click the graph (real time graph is not allowed) to call out the popup menu.


You can Zoom this graph by using mouse:


To Zoom:

1. Press the left mouse button and drag the cursor to select the new extents.
2. Release the mouse button.

To Undo the Zoom - Right click on the graph, there will be a pop-up menu, select Undo Zoom .

DataLogger

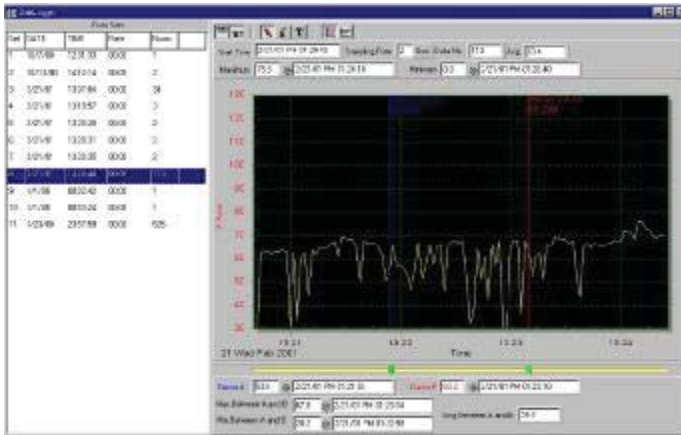

When you have Sound Level DATA LOGGER meter connected to PC and select "DataLogger" from main menu or click  from tool bar to load recorded data from the meter and there will be a progress indicator to show the loading progress. if error occurs, just click "DataLogger" again.

After the data was loaded, the left hand side will show how many data sets were loaded and detail information for each data set (start data, start time, recording rate and record numbers).

for examples:

Data Sets				
Set	DATE	TIME	Rate	Nums
1	1999/7/25	PM 01:24:52	00:02	10
2	1999/7/25	PM 01:25:38	00:02	5142
3	1999/7/25	PM 09:29:08	00:02	21
4	1999/7/25	PM 09:32:04	00:02	3
5	1999/7/25	PM 09:32:09	00:02	1
6	1999/7/25	PM 09:32:14	00:02	9
7	1999/7/25	PM 10:03:43	00:02	1896
8	1999/7/25	PM 11:06:57	00:02	3
9	1999/7/25	PM 11:49:47	00:02	9086

It will transfer first data set to graph and tabular on the right hand side every time after you load recorded data from the Sound Level Meter and you can click at any data set to change the set for graph.



On the right hand side is the waveform graph and statistic of the data set you choose. In reference to graph.

▪ Tutorial - Quick Start to Use SE322 TestLink


(1.) Recording real time data in waveform.

1. Power on the Sound Level Meter first and connect it to a PC RS-232 serial port with the cable(SE-300)
2. Start SE322 program.
3. If the connection is successful the panel will display the same value as the Sound Level Meter. If fail to connect the meter with PC, it will display "No Connection" on the panel window in TestLink Se322.



4. When the connection is successful , click  to start recording real time data and there will be a waveform on the Real Time Graph Window.
5. Click  to start recording .

(2.) How to save the recorded real time data to a file ?

1. Click the graph window you want to save and the graph window will become active , then choose File | Save from main menu or click  from the tool bar .

an active window



not active window




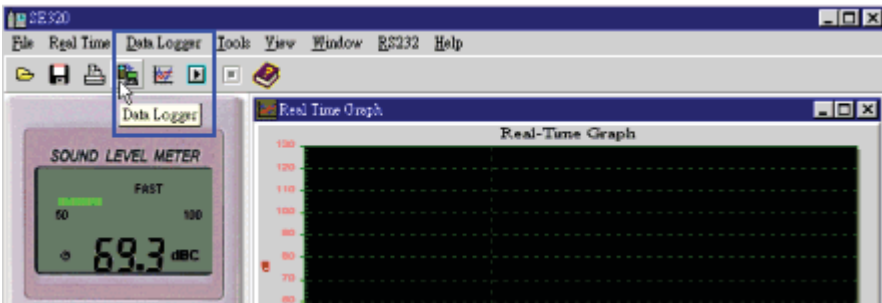
2. There will be a save dialog window for you to choose the file name and file type to save. There are three types of file name you can choose, binary file (*.ghf), text file (*.txt) and EXCEL format file (*.csv). The *.ghf file use much fewer disk space to save the data than the other two file format, but it can only be used in TestLink SE322. Text file can be opened by TestLink SE322 and any other word processor program like word, notepad etc. EXCEL format file can be opened by TestLink SE322 and Microsoft EXCEL.



**(3.) How to load the recorded data from the memory of Sound Level Meter and save it to a file ?
(Only for the model with Data Logger)**

1. Power on the Sound Level Meter.
2. Press the REC button of the meter to start recording data .
3. After a while, press REC button again to stop recording data.

4. Connect the Sound Level Meter to PC
5. Start SE322 program.
6. Choose Data Logger from main menu or click  from tool bar.



7. In reference to Data Logger , see DataLogger.

▪ Frequently Asked Question

1. I had connected Sound Level Meter to PC serial port and turned meter power on, but it still show "NO CONNECTION".

Answer: It could be that all serial port are occupied by other application, close all other application. If it still don't work. Restart your computer and run TestLink SE322 again.

2. How can I save the graph to a file which can be used in EXCEL ?

Answer: When you save a graph to a file , the default file format is ".ghf" and you can select ".csv" to save files. CSV is an EXCEL file format. You can open it in EXCEL.

3. How to uninstall TestLink SE322?

Answer: Uninstall TestLink SE322 by launching the Add/Remove Programs applet out of the Control Panel, highlighting the SE322, and clicking on the Add/Remove... push button, then it will remove the SE322 folder and files from your computer.

4. Why loading data fail?

Answer: This might cause by the slow respond from some of the notebook PC system.

5. How to zoom the graph?

Answer: Press the left mouse button and drag the cursor to select the new extents, then release the mouse button.

6. When I setup the real time sampling with a fast rate (eg. 0.1 sec), Some of the sampling data might be lost.

Answer: This might be caused by slow response time of the PC.